

## EGT sensor with weld-in mounting installation manual

Version 1.1, May 2011

- 1) Select the header/dump pipe in which you wish to mount the probe.
- 2) Locate the sensor location point on dump pipe. Each make and model of snowmobile and ATV has a specific location for the EGT sensor on the factory-equipped pipes. If you have aftermarket pipe. Your system will require a sensor location that is very different than the factory location. Consult your dealer or manufacture for their suggested location.
- 3) Once the spot is located, drill an 8 mm (5/16") diameter hole in the header tube.
- 4) Use a small mechanics magnet that will pass through the hole to the bottom wall to retrieve drill and tap shavings. Clean shavings from magnet and search for more shavings until the magnet comes back clean.
- 5) Center the weld-in weldment on the hole and weld to the header pipe a full 360 degrees.
- 6) With the sensor inserted through the untightened fitting, measure the sensors immersion depth into the exhaust stream. The correct immersion should be 1/3 to 1/2 the diameter of the exhaust pipe. This immersion will not cause a significant restriction in exhaust flow or horsepower. When the depth has been selected, mark the sensor probe at the location just above the compression nut with a marker or pencil. If more than one probe is to be mounted, it is important to that all probes be located at the same immersion depth.
- 7) With the sensor transition spring lead wire at the 90 degree angle from the exhaust pipe and using a short 14 mm (or 9/16") open end wrench, tighten the compression nut until the sensor is unable to rotate in the hardware..
- 8) Route the lead wire toward the firewall taking precaution to keep it away from hot and moving parts. Do not harnesses the lead wire tightly. Make long sweeping bends and loosely guide the lead wire to the instrument using the harness ties. This will allow the wire to absorb the engine vibration along the wires length,

**NOTE: Do NOT cut or splice the thermocouple lead wire as it is special wire that provides correct reading to the gauge. Simply coil any excess wire out of the way. If the thermocouple wire is too short, call the factory for longer leads. When disassembling the sensor, place the ferrule (olive) in a safe place for later use.**

